

Work Order ID 77433

77433

Page 1

December-07-11 7:44:17 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Crosstube Aft

Stop *NS2*

Start Date: 07/12/2011 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 28/12/2011 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 11/12/07 Tooling:

Date:

Run Start *NR1*

QC: Date: SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D412-664-243	E/DEO

100 0.00

100

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D412-664-203 CHG 008

0.00

5-11-12/19

For MLJ 11-12-19

①

110 0.00

110

Packaging

Packaging

Packaging

Memo

0.00

TW

11-12-12

120 0.00

120

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010

0.00

TW

11-12-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77433

77433

Page 2

December-07-11 7:44:17 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 07/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 28/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start ***NR1***

QC: Date: SPC (Y/N): Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130 QC15- Crosstube Dimensional Check

0.00

130

QC

Memo

0.00

Quality Control

140

0.00

140

Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers.

2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-SCRIBE PART # & BATCH #

4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243

11-12-12

11-12-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77433***77433***

Page 3

December-07-11 7:44:17 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 07/12/2011 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 28/12/2011 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150 Crosstubes Chemical Conversion

0.00

150

TW

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

11-12-13

160 QC3- Inspect Part Finish

0.00

160

QC

Memo

0.00

Quality Control

8/12/15

170 QC5- Inspect part completeness to step on W/O

0.00

170

QC

Memo

0.00

Quality Control

8/12/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77433

77433

Page 4

December-07-11 7:44:17 AM

Item ID: D412-664-203 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Aft
Start Date: 07/12/2011 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 28/12/2011 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	Outsource process - NDT per QSI038 4.1	0.00							
180									
Outsource2	Memo	0.00							
Outsource process - NDT	Liquid Penetrant Inspection as per QSI 038Or Issue P/O: <u>15683</u> LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order <u>P/O: 15683</u>								<u>11-12-13</u> 6
190	Packaging	0.00							
190									
Packaging	Memo	0.00							
Packaging	Inspect for transit damage Ensure copy of NDT results attached to work order.								<u>11/12/13</u> <u>11/14/13</u>
200	QC5- Inspect part completeness to step on W/O	0.00							
200									
QC	Memo	0.00							
Quality Control	Inspect for damage & ensure results are as per Dwg D412-664-203								<u>11-12-13</u> (Signing for Matt Munday)

W/O: 77433		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D412-664-203 PAR #: _____ Fault Category: Landing Gear NCR: Yes No DQA: Aut Date: 12/01/03
 Resolution: Rework Disposition: Rework QA: N/C Closed Date: 12/01/03

NCR: 11-10584		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11/12/03	#190	tube was loose at NDT testing. R.C. Process.	CP 11.12.14 OS/042	→ Grind complete tube as per instruction of NDT inspection → Re-align as per Q52004	MO 11-12-19 MO 11-12-19	5 11/12/19	CP 11.12.14 OS/042	5 11/12/13
			CP 11.12.14	Re NDT inspect. Attach donut b.			CP 11.12.14	5 11/12/13

NOTE: Date & initial all entries

Work Order ID 77433

77433

Page 5

December-07-11 7:44:17 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Aft

Start Date: 07/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 28/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

0.00

210

SprayPaint

0.00

SprayPaint

Memo

Mask underside of crosstube as shown

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per DEO D412-664-243 and QSI 005 4.2

PRIME:

Start Time: 3:00 7/11/12/16

Finish Time: 4:00

PAINT:

Start Time: 9:30 7/11/12/17

Finish Time: 10:30

220

QC14- Inspect Spray Paint

0.00

220

QC

Memo

Then, Wrap in plastic bag to protect from scratches

Quality Control

8/11-12/17
(5.3 hours for
mask underside)

8/11/12/19

(40)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77433

Page 6

N900040100

Setup Start *NS1*

Stop ***NS2***

Start Date: 07/12/2011 **Start Qty:** 1.00 ***1***

Required Date: 28/12/2011 **Req'd Qty:** 1.00 *** 1 ***

Reference:

Approvals: _____ **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

230

230

Crosstubes

Crosstubes

Crosstubes

Memo

Assemble as per Dwg D412-664-203

1- Install chafing shield as per DEO D412-664-243. Top holes should be facing up.

A/R Proseal 890 Batch: 119396
EXP: 12-05

2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

3-Install support with Scotch-Weld DP460 and install clamps as per DEO Dwg D12-664-243 using installaiton jig DT9024. Torque clamps as per dwg

A/R Scotch-Weld DP460 Batch: 119341
EXP: 12-10-21

240

QC5- Inspect part completeness to step on W/O	0.00
-----------------------------------------------	------

240

QC

Quality Control

Memo

0.00

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77433

77433

Page 7

December-07-11 7:44:17 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Aft

Start Date: 07/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 28/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

250

Pick Kit

0.00

250

Packaging

Memo

0.00

Packaging

11/12/11

260

QC4- 100% Inspect kits for completeness

0.00

260

QC

Memo

0.00

Quality Control

5/12/11

70

270

Packaging

0.00

270

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D412-664-203
 *****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27
 for application time & date *****
 Time & date of packaging: _____
 Location: _____

Rec'd

11/12/11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77433***77433***

Page 8

December 07-11 7:44:17 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 07/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 28/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
280	QC21- Final Inspection - Work Order Release	0.00							
280									
QC	Memo	0.00							
Quality Control									

11/12/19 *[Signature]*
MS
11-12-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-07-11 7:44:22 AM

Page 1

Work Order ID: 77433

77433

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Crosstube Aft

Start Date: 07/12/2011

Required Date: 28/12/2011

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:E04.02.16Reformat; Added D3189-1K/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 06.12.08 per ECN 886 EC
 IPP Rev:H 07-04-30 As per Rev D JLM
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J
 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K
 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D412-664-203TRN		Manufactured	No			110	Each	6.0000	1	1			

D412-664-203TRN

Crosstube Turning Detail

**

Location	Loc Qty	Loc Code
LG	6	
76825	1	
77198	1	
77199	1	
77305	1	
77306	1	
77307	1	

D2896-1

Manufactured No

230

Each

33.0000

1

1

D2896-1

Support

Location	Loc Qty
LG053	33
71502	12
74465	21

Loc Code

**

41 11/12/11

(5.3 bins for material)

x/

11/12/11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-07-11 7:44:22 AM

Page 2

Work Order ID: 77433

77433

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Crosstube Aft

Start Date: 07/12/2011

Required Date: 28/12/2011

Start Qty: 1.00

Required Qty: 1.00

D3189-1

Manufactured

No

230

Each

42.0000

2

2

D3189-1

Chafing Shield

Location

Loc Qty

Loc Code

FG

4

36065

4

LG053

38

71353

22

73534

16

**

11-12-19
(signing for Matt Wundach)

11.12.18

D3595-063-570

Manufactured

No

230

Each

138.0000

2

2

D3595-063-570

RUBBER CUSHION

Location

Loc Qty

Loc Code

FG

8

37971

1

42243

7

MAT052

130

71534

53

76546

77

**

11-12-19
(signing for Matt Wundach)

11.12.18

MS21920-28

Purchased

No

230

Each

36.0000

4

4

MS21920-28

Clamp(per MIL-DTL-8783C)

Location

Loc Qty

Loc Code

FG

5

105884

5

LG050

31

116839

2

118713

4

119285

25

**

119920 x 4
11-12-19
(signing for Matt Wundach)

11.12.18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-07-11 7:44:22 AM

Page 3

Work Order ID: 77433

77433

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Crosstube Aft

Start Date: 07/12/2011

Required Date: 28/12/2011

Start Qty: 1.00

Required Qty: 1.00

MS21920-30

Purchased

No

230

Each

102.0000

2

2

MS21920-30

clamp(per MIL-DTL-8783C)

**

11.12.18

Location

Loc Qty

Loc Code

LG

50

119529

50

LG050

38

117998

38

LG051

14

111258

14

11-12-19
SIGNING for
MUTLUND

AN6-40A

Purchased

No

250

Each

76.0000

4

4

AN6-40A

Bolt

**

Location

Loc Qty

Loc Code

ST342

76

119449

26

119749

50

Purchased

No

250

Each

45.0000

2

2

AN6-41A

AN6-41A

Bolt

**

Location

Loc Qty

Loc Code

ST342

45

119449

25

119749

20

Purchased

No

250

Each

0.0000

18

18

AN960.D616

NAS1149D0663J

AN960.D616

Washer

**

1119075 11/12/18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-07-11 7:44:22 AM

Page 4

Work Order ID: 77433

77433

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Crosstube Aft

Start Date: 07/12/2011

Required Date: 28/12/2011

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased

No

250

Each

1,394.000

6

6

MS21042L 6

Nut

**

11/12/11

Location

Loc Qty

Loc Code

ST300

394

117677

25

118384

5

118927

48

118968

266

119736

50

ST518

1000

119075

1000

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 77433
Description: Crosstube High Aft (412)		Part Number: D412-664-203
Inspection Dwg: D412-664-243	Rev: E	Page 1 of 1

Required Dimension	Min	Max
Height	24.24	24.50
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70

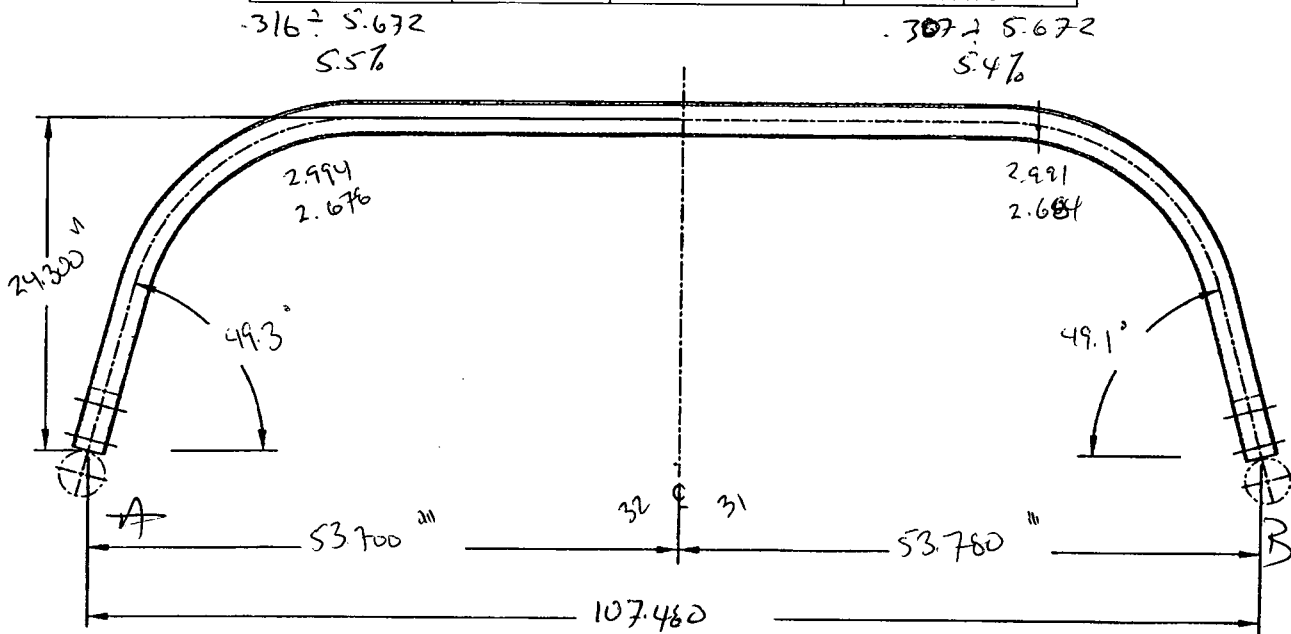

Comments
Size A = 5.5% crushy @ 32 passes
Size B = 5.4% crushy @ 31 passes

QC15 Inspection	8
Date	11/12/12

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOW
REVIS
ENCLOSURE
UNCONTROLLED
SUBJECT TO

WITH
WORK
NO. 33433 M.L.J
11/12/07

② DEO ATTACHED

RELEASED
2009-10-29

E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	RF		
MFG. APPR.	RF		
APPROVED	RF		
DE APPR.	RF	DRAWING NO. REV. E D412-664-243 SHEET 1 OF 4 TITLE SCALE CROSSTUBE ASSEMBLY (412 HI AFT) NTS	
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


77433

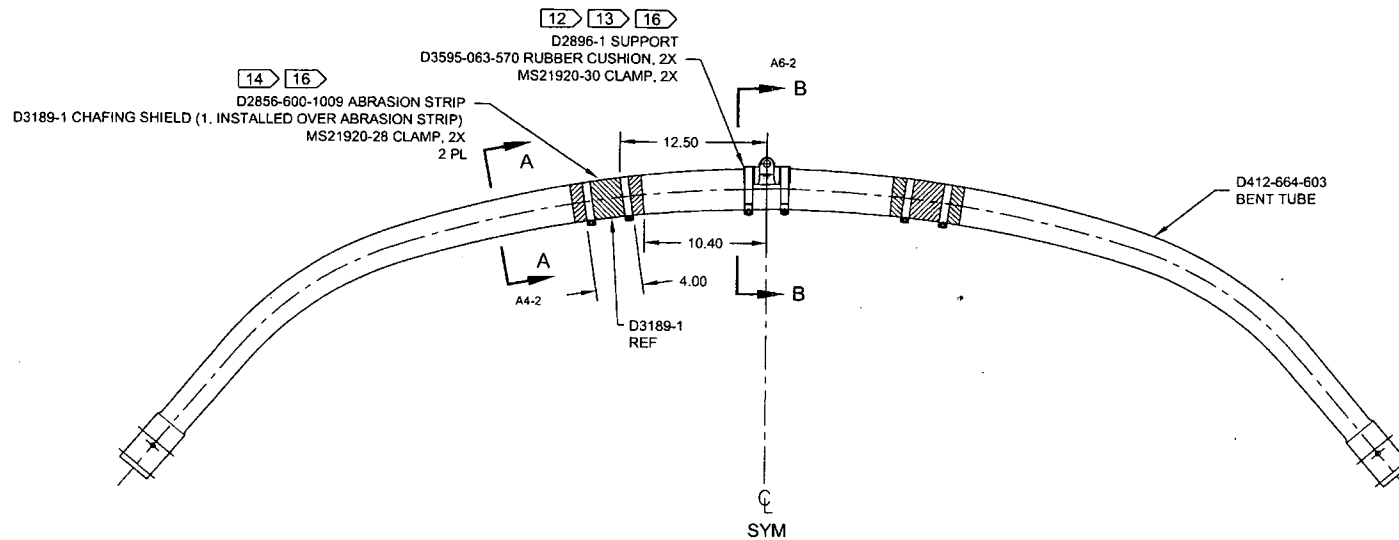

D212-664-243
ASSEMBLY DETAIL

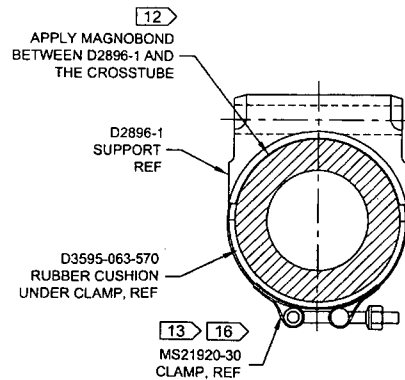

SECTION B-B D4-2
SCALE 4X

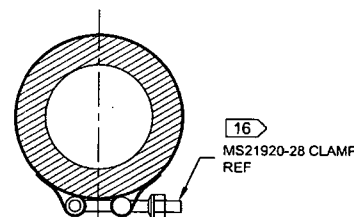

SECTION A-A C6-2
SCALE 4X

2 DEO ATTACHED

RELEASED
2009-10-28
NRP

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	DS	D412-664-243	SHEET 2 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

A horizontal number line with tick marks labeled 1 through 8 from right to left. The line is divided into segments by these tick marks.

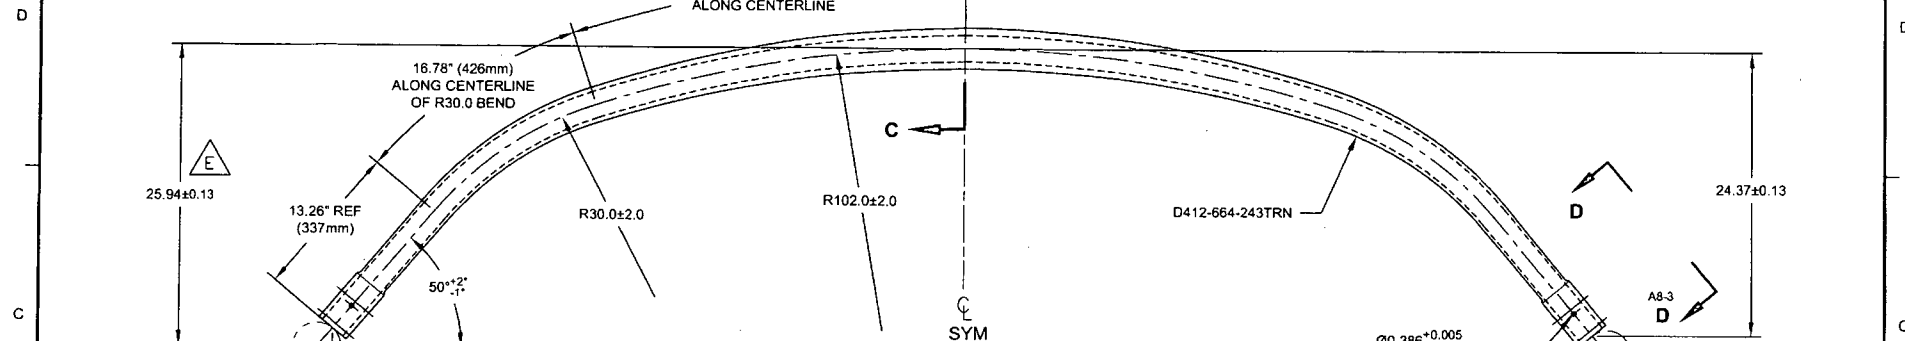

10

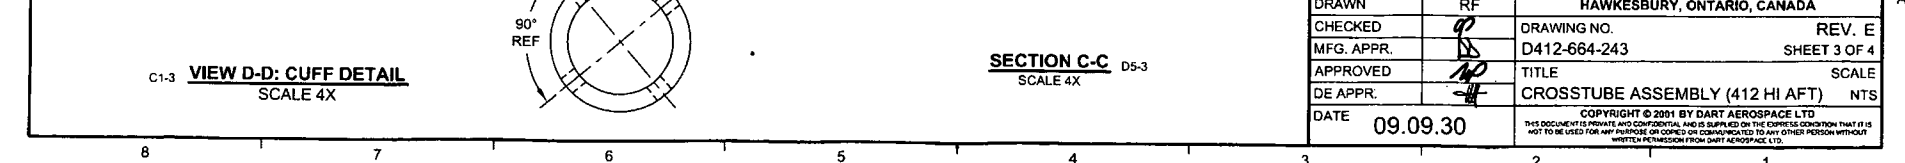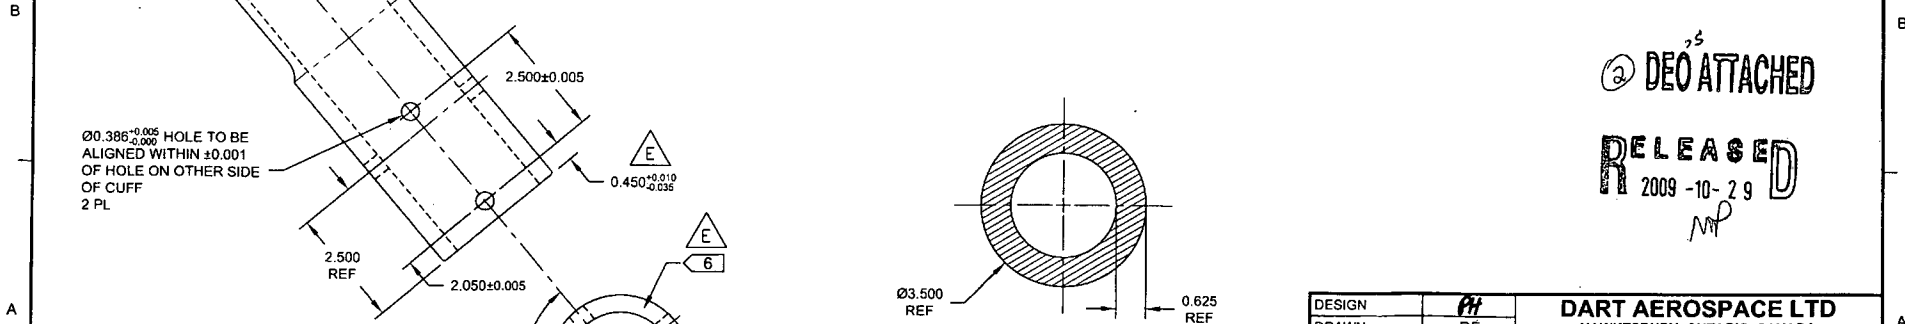

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	SS	D412-664-243	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	HF	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PREPARED AND CONTROLLED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCIAL OR NON-COMMERCIAL BY ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

97433

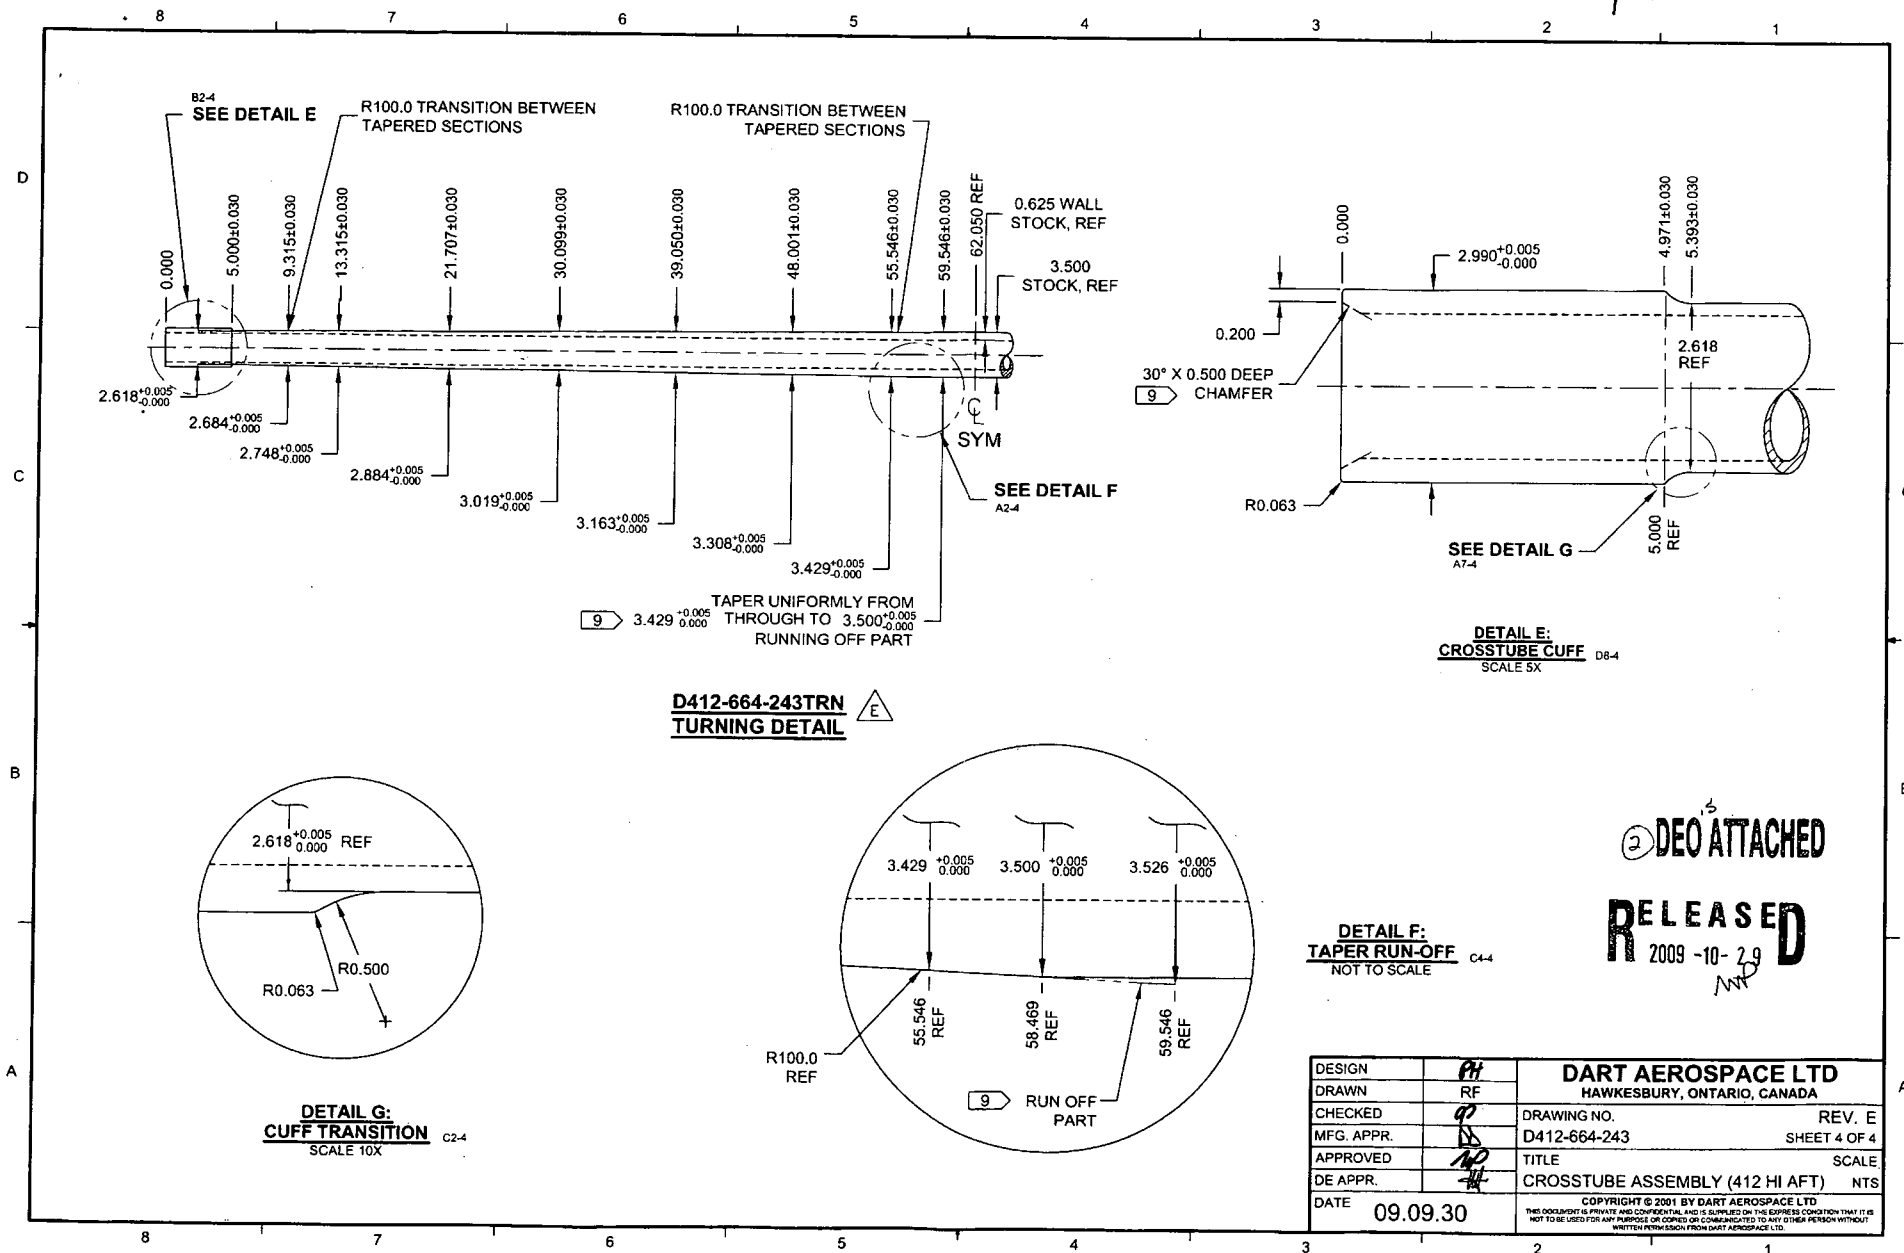

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77433

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED		DE APPR.		
DATE 11.03.31	DATE 11/03/31	DATE 11.03.31	DATE 11/03/31		DATE 11-03-31		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

WAS:

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-07
MD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77433

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN <i>[Signature]</i>	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DE APPR. <i>[Signature]</i>		
DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31		

IS:

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

D412-664-603
BENT TUBE

2.00
1.00


WAS:

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

D3189-1
REF

**D412-664-243
ASSEMBLY DETAIL**

RELEASED
2011-04-07
[Signature]

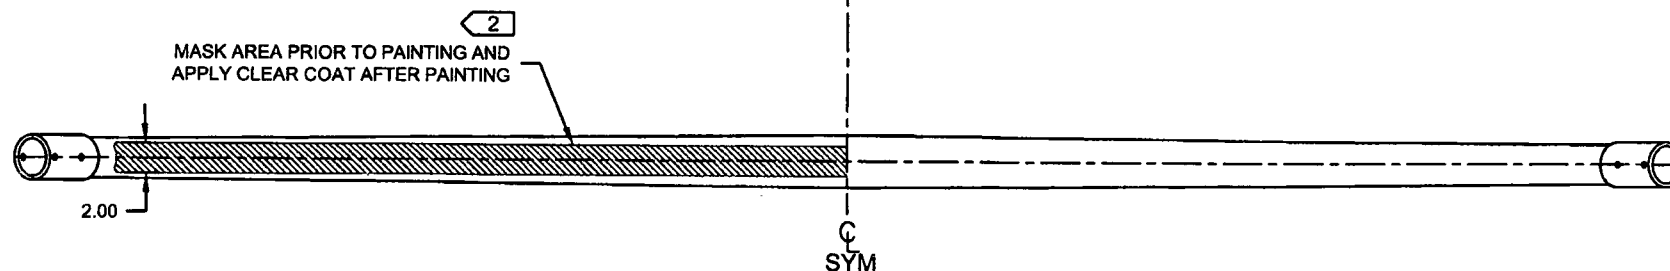

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77433

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>JP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>EE</i>	APPROVED <i>MP</i>		DE APPR. <i>#</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---------------------------------------------------------------------------------------------------------------

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P- 12244

CLIENT	<u>DART Aerospace</u>	DATE	<u>DEC. 3-2011</u>	PAGE	<u>1</u>	OF	<u>1</u>
ATTENTION	<u>CHN TEL</u>	ACUREN JOB NO.	<u>188-11-0833</u>	TIME	AM <input checked="" type="checkbox"/>	PM	<input type="checkbox"/>
ADDRESS	<u>1270 ABEL DEEN</u> <u>HAWKES BURY, ON.</u>	PO/WO No.	<u>-</u>	WORK LOCATION	<u>SAVE</u>	ACCEPTANCE STD	<u>ASIN 1417/051-CSP</u>
PROJECT	<u>F.P.I. on CROSS TUBES</u>	REV./DATE	<u>2005</u>				
ITEM(S) EXAMINED							

JOB DESCRIPTION	PROCEDURE NO.	LT- <u>002</u>	REV./DATE	<u>2008</u>	TECHNIQUE NO.	LT- <u>1012</u>	REV./DATE	<u>2008</u>
PART NO.	<u>SEE RESULTS</u>		MATERIAL	<u>ANODIZED ALUMINUM</u>	THICKNESS	<u>VARIOUS</u>		
SCOPE	<u>A NET FLOUORESCENT LIQUID PENETRANT INSPECTION WAS</u> <u>CARRIED OUT ON 100% EXTERNAL SURFACE.</u>							

TEST DETAILS							
METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED		
FAMILY BRAND	<u>MONA FLUX</u>		BLACK LIGHT S/N	<u>10459</u>	<input type="checkbox"/> OUTPUT > 1000 μ W/cm ²	<input type="checkbox"/> AMBIENT < 2 fc	
PENETRANT	<u>2007</u>	MINIMUM DWELL TIME	<u>450</u>	MIN.	LIGHTING EQUIP.	<input type="checkbox"/> FLASHLIGHT	<input type="checkbox"/> TROUBLELIGHT
PENETRANT REMOVER	<u>H2O</u>	MINIMUM DRY TIME	<u>>10</u>	MIN.	OTHER	<u>LASINO</u>	
DEVELOPER	<u>SDS2</u>	MINIMUM DWELL TIME	<u>10</u>	MIN.	LIGHT METER S/N	<u>1098866</u>	CAL DUE DATE
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input checked="" type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY	<u>FEB 2 2012</u>			

TEST SURFACE					
SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input type="checkbox"/> AS WELDED	<input type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < -4°C/ 20°F	<input type="checkbox"/> -4°C/ 20°F TO 10°C/50°F	<input type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

RESULTS-	(<input type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL)
<u>1</u> <u>CROSS TUBE W.O. 77413</u>	<input checked="" type="checkbox"/>
<u>1</u> <u>CROSS TUBE W.O. 77415</u>	<input checked="" type="checkbox"/>
<u>1</u> <u>CROSS TUBE W.O. 77412</u>	<input checked="" type="checkbox"/>
<u>1</u> <u>CROSS TUBE W.O. 77414</u>	<input checked="" type="checkbox"/>
<u>1</u> <u>CROSS TUBE W.O. 77434</u>	<input checked="" type="checkbox"/> - <u>REGRIND</u>
<u>1</u> <u>CROSS TUBE W.O. 77433</u>	<input checked="" type="checkbox"/> - <u>REGRIND</u>

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES			
CLIENT REPRESENTATIVE	<u>Matthew Murdoch</u>	PRINT	SIGNATURE
TECHNICIAN (SIGNATURE):	<u>Mike J. Harris</u>	1 st TECHNICIAN	2 nd TECHNICIAN
NAME (PRINT):	<u>Mike J. Harris</u>	CGSB LEVEL <u>II</u>	SNT LEVEL <u>II</u>
	<u>CGSB REG. NO. 6606</u>	CGSB LEVEL	SNT LEVEL
		CGSB REG. NO.	
DTR #		REPORT REVIEWED BY:	
		NAME	INITIALS



LIQUID PENETRANT TEST REPORT

P- 12245

PAGE 1 OF 1

CLIENT DART Aerospace DATE DEC. 16 - 2011 TIME AM ☒ PM ☐
ATTENTION CHANTAL ACUREN JOB NO. 188-11-0852
ADDRESS 1270 ABERDEEN STREET POWO No. ---
WAKESBURY MA WORK LOCATION SAME
PROJECT F.P.I. on CROSS TUBES ACCEPTANCE STD. ASME 1417/3103 REV./DATE 2005
ITEM(S) EXAMINED ②

JOB DESCRIPTION PROCEDURE NO. LT-2008 REV./DATE 2008 TECHNIQUE NO. LT-2002 REV./DATE 2008
PART NO. SEE RESULTS MATERIAL ANODIZED ALUMINUM THICKNESS VARIABLES
SCOPE 1 WET FLUORESCENT LIQUID PENETRANT INSPECTION
WAS CARRIED OUT 100% EXTERNAL SURFACE

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNA FLUX BLACK LIGHT S/N 10459 ☐ OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc
PENETRANT 2007 MINIMUM DWELL TIME 430 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER W20 MINIMUM DRY TIME >10 MIN. OTHER
DEVELOPER SK 2 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N 1070866 CAL DUE DATE FEB 2 2012
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☐ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < -4°C/20°F ☐ -4°C/20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ☒ METRIC ☐ IMPERIAL

1 CROSS TUBE W.O. 77434 ✓
1 CROSS TUBE W.O. 77433 ✓
(ET 11 12-19
(signing for Matt Mordach)

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES
CLIENT REPRESENTATIVE Matthew Mordach DTR # E 10919
TECHNICIAN (SIGNATURE): Mike Johnston REPORT REVIEWED BY:
NAME (PRINT): Mike Johnston 1ST TECHNICIAN NAME INITIALS
CGSB LEVEL 2 SNT LEVEL 2 CGSB LEVEL --- SNT LEVEL ---
CGSB REG. NO. 6606 CGSB REG. NO. ---

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

5.0 PARTS LIST

REFERENCE ONLY

5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/-241 OR D412-664-243 ASSEMBLIES ABOVE
NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AAI
SKIDTUBES.

Location/Lot Activity

Thursday, March 29, 2012 12:36:44 PM

Page 1 of 3

Criteria : All Items All Locations Lot: 71502 All Transaction Types All Dates Report on Locations & Lots

Transaction Type	Item ID/ Item Name	Warehouse Location ID	Reason	Employee ID Location Code	Loc Trans Date	LocQtyPrior/ Location Qty	Lot Number	LotQtyPrior/ Lot Qty	Shelf Life Date Lot Code	Extended Cost
Account Value Change	D2896-1 / Support	Main Warehouse		FAUT01		20.0000		20.0000		
		LG			10/19/2011	-20.0000	71502	-20.0000		(\$6,397.93)
		Main Warehouse		FAUT01		20.0000		20.0000		
		LG			10/19/2011	20.0000	71502	20.0000		\$6,397.93
								0.0000		\$0.00
Inv Adjustment	D2896-1 / Support	Main Warehouse	Found	FAUT01		21.0000		0.0000		
		LG053			3/7/2012	1.0000	71502	1.0000		\$319.90
		Main Warehouse	Found	FAUT01		21.0000		0.0000		
		LG053			3/7/2012	1.0000	71502	1.0000		\$319.90
		Main Warehouse	B/N correction	GOLD01		21.0000		0.0000		
		LG053			3/23/2012	1.0000	71502	1.0000		\$319.90
		Main Warehouse	B/N correction	GOLD01		21.0000		0.0000		
		LG053			3/27/2012	1.0000	71502	1.0000		\$319.90
								4.0000		\$1,279.59
Issue	D2896-1 / Support	Main Warehouse	73691	QUIR01		20.0000		20.0000		
		LG			10/19/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	73690	QUIR01		19.0000		19.0000		
		LG			10/19/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	75417	QUIR01		18.0000		18.0000		
		LG			11/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	75416	QUIR01		17.0000		17.0000		
		LG			11/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	74376	FAUT01		16.0000		16.0000		
		LG			11/21/2011	-1.0000	71502	-1.0000		(\$319.90)

Transaction Type	Item ID/ Item Name	Warehouse Location ID	Reason	Employee ID Location Code	Loc Trans Date	LocQtyPrior/ Location Qty	Lot Number	LotQtyPrior/ Lot Qty	Shelf Life Date Lot Code	Extended Cost
Issue	D2896-1 / Support	Main Warehouse	74377 -203	FAUT01		15.0000		15.0000		
		LG			11/21/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	76351 -203	DESJ02		35.0000		14.0000		
		LG053			12/6/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	76350 -203	DESJ02		34.0000		13.0000		
		LG053			12/6/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77108 -203	DESJ02		33.0000		12.0000		
		LG053			12/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77273 -203	LAVO01		32.0000		11.0000		
		LG053			12/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77109 -203	DESJ02		31.0000		10.0000		
		LG053			12/13/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77433	QUIR01		30.0000		9.0000		
		LG053			12/19/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77434	QUIR01		29.0000		8.0000		
		LG053			12/20/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77748	FAUT01		28.0000		7.0000		
		LG053			1/6/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77533	FAUT01		27.0000		6.0000		
		LG053			1/6/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77534	FAUT01		26.0000		5.0000		
		LG053			1/6/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	78576	FAUT01		25.0000		4.0000		
		LG053			2/22/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	78574	FAUT01		24.0000		3.0000		
		LG053			2/22/2012	-1.0000	71502	-1.0000		(\$319.90)

Issued
 71502
 11/10/13
 11/10/19
 74465

Transaction Type	Item ID/ Item Name	Warehouse Location ID	Reason	Employee ID Location Code	Loc Trans Date	LocQtyPrior/ Location Qty	Lot Number	LotQtyPrior/ Lot Qty	Shelf Life Date Lot Code	Extended Cost
Issue	D2896-1 / Support	Main Warehouse LG053	78575	FAUT01		23.0000		2.0000		
					2/22/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	78573	GOLD01		22.0000		1.0000		
					2/24/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80135	FAUT01		22.0000		1.0000		
					3/7/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80134	FAUT01		22.0000		1.0000		
					3/7/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80585	GOLD01		22.0000		1.0000		
					3/23/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80584	GOLD01		22.0000		1.0000		
					3/27/2012	-1.0000	71502	-1.0000		(\$319.90)
									-24.0000	(\$7,677.51)
Loc Transfer	D2896-1 / Support	Main Warehouse LG053		GOLD01		0.0000		0.0000		
					11/30/2011	14.0000	71502	14.0000		\$4,478.55
		Main Warehouse LG		GOLD01		14.0000		14.0000		
					11/30/2011	-14.0000	71502	-14.0000		(\$4,478.55)
									0.0000	\$0.00
WIP Receipt	D2896-1 / Support	Main Warehouse LG	71502	GOLD01		0.0000		0.0000		
					10/3/2011	20.0000	71502	20.0000		\$6,397.93
									20.0000	\$6,397.93